# IPS1-120-48



## **FEATURES**

- Supports 90 264 VAC / 127 370 VDC
- Efficiency up to 89 %
- Protection against short circuit, overload, overvoltage & over temperature
- Cooling by free air convection
- UL 508 approved

## **INTENDED USE**

This device is designed for installation in an enclosure and is intended for the general professional use such as in instrumentation equipment, office, industrial control and communication .

Do not use this power supply in equipment where malfunction may cause severe personal injury or threaten human life.

INPUT SPECIFICATIONS		
INPUT VOLTAGE RANGE	100 - 240 VAC ± 10 %; 127 - 370 VDC	
FREQUENCY RANGE	50 - 60 Hz	
EFFICIENCY (TYP.)	Up to 89 % @ 230 VAC	
AC CURRENT (TYP.)	2.2 A @ 115 VAC; 1.5 A @ 230 VAC	
INRUSH CURRENT (TYP.)	< 48 Amps; measured at 264 VAC, 25°C Ambient, Cold start	

OUTPUT SPECIFICATIONS		
OUTPUT VOLTAGE	48 - 56 VDC	
OUTPUT CURRENT	2.5 A at 48 VDC; 2.14 A at 56 VDC	
RIPPLE AND NOISE	< 1 % of Vout *	
LINE AND LOAD REGULATION	± 1 %	
START UP TIME	< 1 sec @ 230 VAC & < 3 sec @ 115 VAC, Full load	
HOLD UP TIME	≥ 60 msec at 230 VAC & ≥ 15 msec at 115 VAC, Full Load	
SERIES OPERATION	Possible for up to two power supplies (with external diode)	


★ Ripple & Noise measured at 20 MHz of bandwidth by using 0.1 uf &10 uf parallel capacitor.

PROTECTIONS		
INPUT FUSE	3.15 A - 250 VAC Internal	
OUTPUT OVER LOAD	≥ 110 % of rated output current Protection type: Hiccup mode; recovers automatically after fault condition is removed.	
OUTPUT SHORT CIRCUIT	Hiccup mode when output is shorted; recovers automatically after fault condition is removed.	
OUTPUT OVER VOLTAGE	56.5 - 65.5 VDC Protection type: Latched; input AC power has to be recycled to recover the power supply.	
OVER TEMPERATURE	Power supply shuts down when the temperature of PCB below main transformer reaches typically 120°C; turns on only after the temperature falls below 90°C typically and AC power is recycled thereafter.	

ENVIRONMENT		
OPERATING TEMPERATURE	- 25°C to + 70°C *De-rate output power at 3 W /°C above + 50°C Ambient.	
STORAGE TEMPERATURE	- 40°C to + 85°C	
HUMIDITY	5 to 95 % RH, Non Condensing	
ALTITUDE	2000 m	

SAFETY & EMC		
SAFETY STANDARDS	UL- 508 approved (File number : E336563) Designed to meet IEC 62368-1	
DIELECTRIC WITHSTAND VOLTAGE	I/P to Earth : 2500 VAC I/P to O/P : 4000 VAC O/P to Earth : 1500 VAC	
INSULATION RESISTANCE	100 $M\Omega$ min. (between all outputs and all inputs / PE terminals) at 500 VDC	
CONDUCTED EMISSION	CISPR32; CLASS A	
RADIATED EMISSION	CISPR32; CLASS A	
EMS IMMUNITY	Compliance to IEC61000-4-4, 5, 11	

MEC	CHANICAL	
DIM	ENSION	43 x 109.8 x 102.7 mm (W x H x D)
WEI	GHT	350 gms

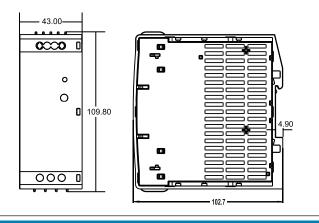

## **WIRING DIAGRAM**



⊕ PE (Protective Earth) Input


## **WIRING INSTRUCTIONS**


Recommended Wire size and Torque


Connector	Wire size	Torque
Input	18 AWG	0.5 Nm
Output	22 AWG	0.5 Nm

- To prevent risk of electric shock, power supply equipment must be kept OFF while wiring.
- 2. Terminals and electrically charged parts must not be touched when the power is ON.
- 3. Wiring shall be done strictly according to terminal layout provided in the operating manual.

Doc. name: OP INST IPS1-120-48 OP3196-V01(Page 1 of 2)

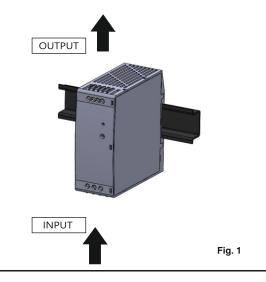

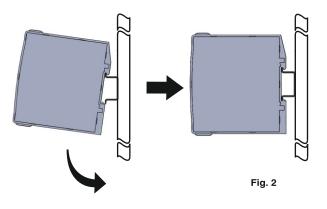

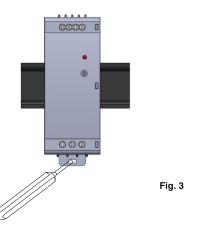

## **INSTALLATION INSTRUCTIONS (POLLUTION DEGREE 2)**

#### Attention: (Fig. 1)

- 1. Do not block the ventilation holes of power supply.
- 2. Keep at least 20 mm clearance around the switching power supply.
- 3. The Equipment should not be installed in environmental conditions other than those specified in this manual.

#### Mounting: (Fig.2)

- 1. Slightly tilt the unit to engage on the top side of Din Rail mounting.
- 2. Press it downward until it gets locked in Din Rail.

#### Removal: (Fig.3)

- Before removing power supply unit from Din Rail ensure that supply has been switched off
- 2. Unscrew all the wire connections of power supply unit.
- 3. Insert a screw driver into the mounting clamp slot & pull it down to remove the power supply from Din Rail.

## **M** WARNING:

#### Risk of electrical shock, fire, personal injury or death.

- 1. Do not use the power supply without proper grounding (Protective Earth).
- Do not use in wet locations or in areas where moisture or condensation can be expected.
- Make sure mains power supply is off before wiring the power supply unit. Make sure of correct wiring. Incorrect wiring may cause electrical shock or damage.
- Do not touch the power supply during operation or immediately after turning
  off because some parts get hot or are at high voltage which may cause
  burns or electrical shock.
- Do not install the power supply where human body may come into contact while power is supplied to the power supply.
- Do not repair the power supply at user end. Modification or repairing of the power supply by users may cause electrical shocks, damage & other accidents.
- If damage or malfunction occurs during operation, immediately turn off mains power.

#### **MEANING OF PRODUCT SAFETY SYMBOL**



Minor electric shock, fire or product failure may occasionally occur. Do not allow any pieces of metal or conductors or any clippings or cuttings resulting from installation work to enter the product.

Un choc électrique mineur, un incendie ou une défaillance du produit peuvent survenir occasionnellement. Ne laissez pas de morceaux de métal ou de conducteurs ou de coupures ou de coupures résultant des travaux d'installation pénétrer dans le produit.



WEEE symbol for Electrical and Electronic Equipment waste management

Symbole DEEE pour la gestion des déchets d'équipements électriques et électroniques

## **SAFETY INSTRUCTIONS**

- > This manual is meant for personnel involved in wiring installation operation & routine maintenance of the equipment.
- Disconnect power supply of your system before starting any installation operation or wiring.
- > Improper installation operation or wiring may impair safety & failure of the unit or electrical shock or damage.
- Connect the ground completely. A protective earthing terminal stipulated in safety standards is used. Electric shock or malfunction may occur if ground is not connected properly.

# c3controls

## Factory Address:

PO Box 496, Beaver, PA 15009,USA Corporate Office:724.775.7926

www.c3controls.com